



Release Notes:

Version Q.10.05 Software

for the ProCurve Series 2510 Switches

Release Q.10.05 supports the ProCurve Switch 2510-24G (J9019A),

These release notes include information on the following:

- Downloading switch software and documentation from the Web ([page 1](#))
- Clarification of operating details for certain software features ([page 8](#))
- A listing of software enhancements in this release ([page 8](#))
- A listing of software fixes included in releases Q.10.02 through Q.10.0x ([page 9](#))

Related Publications

For the latest version of any of the publications listed below, visit the ProCurve Networking Web site at www.procurve.com. Click on **Technical support**, then **Product manuals**.

- Management and Configuration Guide
- Advanced Traffic Management Guide
- Access Security Guide

© Copyright 2007 Hewlett-Packard Company, LP. The information contained herein is subject to change without notice.

Publication Number

5991-6274
March 2007

Applicable Products

ProCurve Switch 2510-24G (J9019A)

Trademark Credits

Microsoft®, Windows®, and Windows NT® are US registered trademarks of Microsoft Corporation. Adobe® and Acrobat® are trademarks of Adobe Systems Incorporated. Java™ is a US trademark of Sun Microsystems, Inc.

Software Credits

SSH on ProCurve Switches is based on the OpenSSH software toolkit. This product includes software developed by the OpenSSH Project for use in the OpenSSH Toolkit. For more information on OpenSSH, visit

[http:// www.openssh.com](http://www.openssh.com).

SSL on ProCurve Switches is based on the OpenSSL software toolkit. This product includes software developed by the OpenSSL Project for use in the OpenSSL Toolkit. For more information on OpenSSL, visit

<http://www.openssl.org>.

This product includes cryptographic software written by Eric Young (eay@cryptsoft.com). This product includes software written by Tim Hudson (tjh@cryptsoft.com)

Disclaimer

HEWLETT-PACKARD COMPANY MAKES NO WARRANTY OF ANY KIND WITH REGARD TO THIS MATERIAL, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. Hewlett-Packard shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Hewlett-Packard assumes no responsibility for the use or reliability of its software on equipment that is not furnished by Hewlett-Packard.

Warranty

See the Customer Support/Warranty booklet included with the product.

A copy of the specific warranty terms applicable to your Hewlett-Packard products and replacement parts can be obtained from your HP Sales and Service Office or authorized dealer.

Hewlett-Packard Company
8000 Foothills Boulevard, m/s 5551
Roseville, California 95747-5551
www.procurve.com

Contents

Software Management	1
Software Updates	1
Downloading Switch Documentation and Software from the Web	1
Downloading Software to the Switch	2
TFTP Download from a Server	3
Xmodem Download From a PC or Unix Workstation	4
Saving Configurations While Using the CLI	5
ProCurve Switch, Routing Switch, and Router Software Keys	6
OS/Web/Java Compatibility Table	7
Clarifications and Updates	8
Enhancements	8
Release Q.10.02 Enhancements	8
Release Q.10.03 Enhancements	8
Release Q.10.04 Enhancements	8
Release Q.10.05 Enhancements	8
Software Fixes in Release Q.10.03 - Q.10.05	9
Release Q.10.02	9
Release Q.10.03	10
Release Q.10.04	11
Release Q.10.05	12

Software Management

Software Updates

Check the ProCurve Networking Web site frequently for free software updates for the various ProCurve switches you may have in your network.


Downloading Switch Documentation and Software from the Web

You can download software updates and the corresponding product documentation from the ProCurve Networking Web site as described below.

To Download a Software Version:

1. Go to the ProCurve Networking Web site at:
www.procurve.com.
2. Click on **Software updates** (in the sidebar).
3. Under **Latest software**, click on **Switches**.

To Download Product Documentation: You will need the Adobe® Acrobat® Reader to view, print, and/or copy the product documentation.

1. Go to the ProCurve Networking Web site at www.procurve.com.
2. Click on **Technical support**, then **Product manuals**.
3. Click on the name of the product for which you want documentation.
4. On the resulting web page, double-click on a document you want.
5. When the document file opens, click on the disk icon  in the Acrobat® toolbar and save a copy of the file.

Downloading Software to the Switch

ProCurve Networking periodically provides switch software updates through the ProCurve Networking Web site (www.procurve.com). After you acquire the new software file, you can use one of the following methods for downloading it to the switch:

- For a TFTP transfer from a server, do either of the following:
 - Select **Download OS** in the Main Menu of the switch's menu interface and use the (default) **TFTP** option.
 - Use the **copy tftp** command in the switch's CLI (see below).
- For an Xmodem transfer from a PC or Unix workstation, do either of the following:
 - Select **Download OS** in the Main Menu of the switch's menu interface and select the **Xmodem** option.
 - Use the **copy xmodem** command in the switch's CLI (page 4).
- Use the download utility in ProCurve Manager Plus.

Note

Downloading new software does not change the current switch configuration. The switch configuration is contained in a separate file that can also be transferred, for example, for archive purposes or to be used in another switch of the same model.

This section describes how to use the CLI to download software to the switch. You can also use the menu interface for software downloads. For more information, refer to the *Management and Configuration Guide* for your switch.

TFTP Download from a Server

Syntax: `copy tftp flash <ip-address> <remote-os-file> [< primary | secondary >]`

Note that if you do not specify the flash destination, the TFTP download defaults to the primary flash.

For example, to download a software file named Q_10_0x.swi from a TFTP server with the IP address of 10.28.227.103:

1. Execute the copy command as shown below:

```
ProCurve # copy tftp flash 10.28.227.103 Q_10_0x.swi
The primary OS image will be deleted. continue [y/n]? Y
03125K
```

2. When the switch finishes downloading the software file from the server, it displays the progress message shown in figure 1. When the CLI prompt re-appears, the switch is ready to reboot to activate the downloaded software:

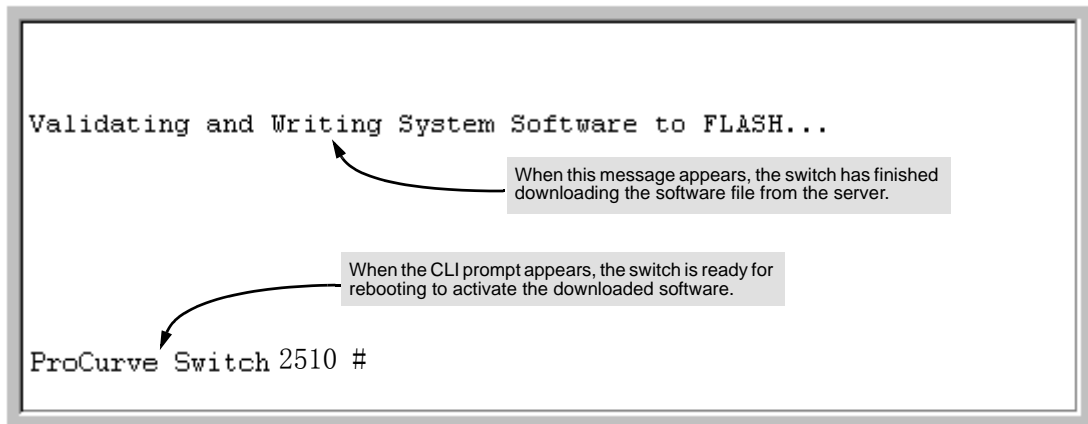


Figure 1. Message Indicating the Switch Is Ready To Activate the Downloaded Software

3. Use the **show flash** command to verify that the new software version is in the expected flash area (primary or secondary)
4. Reboot the switch from the flash area that holds the new software (primary or secondary).

After the switch reboots, it displays the CLI or Main Menu, depending on the **Logon Default** setting last configured in the menu's Switch Setup screen.

Xmodem Download From a PC or Unix Workstation

This procedure assumes that:

- The switch is connected via the Console RS-232 port to a PC operating as a terminal. (Refer to the Installation and Getting Started Guide you received with the switch for information on connecting a PC as a terminal and running the switch console interface.)
- The switch software is stored on a disk drive in the PC.
- The terminal emulator you are using includes the Xmodem binary transfer feature. (For example, in the HyperTerminal application included with Windows NT, you would use the Send File option in the Transfer dropdown menu.)

Using Xmodem and a terminal emulator, you can download a switch software file to either primary or secondary flash using the CLI.

Syntax: `copy xmodem flash [< primary | secondary >]`

1. To reduce the download time, you may want to increase the baud rate in your terminal emulator and in the switch to a value such as 115200 bits per second. (The baud rate must be the same in both devices.) For example, to change the baud rate in the switch to 115200, execute this command:

```
ProCurve(config)# console baud-rate 115200
```

(If you use this option, be sure to set your terminal emulator to the same baud rate.)

Changing the console baud-rate requires saving to the Startup Config with the "write memory" command. Alternatively, you can logout of the switch and change your terminal emulator speed and allow the switch to AutoDetect your new higher baud rate (i.e. 115200 bps)

2. Execute the following command in the CLI:

```
ProCurve # copy xmodem flash primary
The primary OS image will be deleted. continue [y/n]? Y
Press 'Enter' and start XMODEM on your host...
```

3. Execute the terminal emulator commands to begin the Xmodem transfer. For example, using HyperTerminal:
 - a. Click on Transfer, then Send File.
 - b. Type the file path and name in the Filename field.
 - c. In the Protocol field, select Xmodem.
 - d. Click on the Send button.

The download can take several minutes, depending on the baud rate used in the transfer.

4. If you increased the baud rate on the switch ([step 1](#)), use the same command to return it to its previous setting. HP recommends a baud rate of 9600 bits per second for most applications. Remember to return your terminal emulator to the same baud rate as the switch.

5. Use the **show flash** command to verify that the new software version is in the expected flash area (primary or secondary)
6. Reboot the switch from the flash area that holds the new software (primary or secondary).

After the switch reboots, it displays the CLI or Main Menu, depending on the **Logon Default** setting last configured in the menu's Switch Setup screen.

Saving Configurations While Using the CLI

The switch operates with two configuration files:

- **Running-Config File:** Exists in volatile memory and controls switch operation. Rebooting the switch erases the current running-config file and replaces it with an exact copy of the current startup-config file. To save a configuration change, you must save the running configuration to the startup-config file.
- **Startup-Config File:** Exists in flash (non-volatile) memory and preserves the most recently-saved configuration as the “permanent” configuration. When the switch reboots for any reason, an exact copy of the current startup-config file becomes the new running-config file in volatile memory.

When you use the CLI to make a configuration change, the switch places the change in the running-config file. If you want to preserve the change across reboots, you must save the change to the startup-config file. Otherwise, the next time the switch reboots, the change will be lost. There are two ways to save configuration changes while using the CLI:

- Execute **write memory** from the Manager, Global, or Context configuration level.
- When exiting from the CLI to the Main Menu, press **[Y]** (for Yes) when you see the “save configuration” prompt:

```
Do you want to save current configuration [y/n] ?
```


Software Management

ProCurve Switch, Routing Switch, and Router Software Keys

ProCurve Switch, Routing Switch, and Router Software Keys

Software Letter	ProCurve Networking Products
C	1600M, 2400M, 2424M, 4000M, and 8000M
CY	Switch 8100fl Series (8108fl and 8116fl)
E	Switch 5300xl Series (5304xl, 5308xl, 5348xl, and 5372xl)
F	Switch 2500 Series (2512 and 2524), Switch 2312, and Switch 2324
G	Switch 4100gl Series (4104gl, 4108gl, and 4148gl)
H	Switch 2600 Series, Switch 2600-PWR Series: H.07.81 and earlier, or H.08.55 and greater, Switch 2600-8-PWR requires H.08.80 or greater. Switch 6108: H.07.xx and earlier
I	Switch 2800 Series (2824 and 2848)
J	Secure Router 7000dl Series (7102dl and 7203dl)
K	Switch 3500yl Series (3500yl-24G-PWR and 3500yl-48G-PWR), Switch 6200yl-24G, and 5400zl Series (5406zl, 5406zl-48G, 5412zl, and 5412zl-96G)
L	Switch 4200vl Series (4204vl, 4208vl, 4202vl-72, and 4202vl-48G)
M	Switch 3400cl Series (3400-24G and 3400-48G): M.08.51 through M.08.97, or M.10.01 and greater; Series 6400cl (6400cl-6XG CX4, and 6410cl-6XG X2): M.08.51 through M.08.95, or M.08.99 to M.08.100 and greater.
N	Switch 2810 Series (2810-24G and 2810-48G)
P	Switch 1800 Series (Switch 1800-8G – PA.xx; Switch 1800-24G – PB.xx)
Q	Switch 2510 Series (2510-24)
T	Switch 2900 Series (2900-24G, and 2900-48G)
WA	ProCurve Access Point 530
WS	ProCurve Wireless Edge Services xl Module and the ProCurve Redundant Wireless Services xl Module
numeric	Switch 9408sl, Switch 9300 Series (9304M, 9308M, and 9315M), Switch 6208M-SX and Switch 6308M-SX (Uses software version number only; no alphabetic prefix. For example 07.6.04.)

Version Q.10.01 is the first software release for the ProCurve Series 2510 switches.

OS/Web/Java Compatibility Table

The switch web agent supports the following combinations of OS browsers and Java Virtual Machines:

Operating System	Internet Explorer	Java
Windows NT 4.0 SP6a	5.00, 5.01 5.01, SP1 6.0, SP1	Sun Java 2 Runtime Environment: – Version 1.3.1.12 – Version 1.4.2.05
Windows 2000 Pro SP4	5.05, SP2 6.0, SP1	
Windows XP Pro SP2	6.0, SP1	Sun Java 2 Runtime Environment: – Version 1.5.0.02
Windows Server SE 2003 SP1	6.0, SP1	

Clarifications and Updates

There are currently no clarification or updates to existing documentation related to the Series 2510 Switches, or Q.10.0x code.

Enhancements

Unless otherwise noted, each new release includes the enhancements added in all previous releases.

Enhancements are listed in chronological order, oldest to newest software release.

Release Q.10.02 Enhancements

Release Q.10.02 includes the following enhancements:

- **Enhancement (PR_1000351445)** — The "show tech transceiver" CLI command output now contains the HP part number and revision information for all transceivers on the switch

Release Q.10.03 Enhancements

Release Q.10.03 includes the following enhancements:

- **Enhancement (PR_1000379804)** — Historical information about MAC addresses that have been moved has been added to the "show tech" command output.

Release Q.10.04 Enhancements

Release Q.10.04 (never released) includes the following enhancements:

- **Enhancement (PR_1000365862)** — This portion of the enhancement added the option of configuring ports that had been previously disabled by BPDU Protection to be automatically re-enabled.
- **Enhancement (PR_1000373226)** — Support was added for a future SFP transceiver.

Release Q.10.05 Enhancements

This release contains software fixes only, no new enhancements.

Software Fixes in Release Q.10.03 - Q.10.05

Software fixes are listed in chronological order, oldest to newest software release.

Unless otherwise noted, each new release includes the fixes added in all previous releases.

Release Q.10.01 was the first software release for the ProCurve 2510 Series switches.

Release Q.10.02

Problems Resolved in Release Q.10.02 (not a general release)

- **802.1x (PR_1000366179)** — Open VLAN supplicants that fail 802.1X authentication can access the authorized VLAN.
 - **802.1x (PR_1000366395)** — Enabling port-access authentication on gig ports causes the switch to crash.
 - **Authorization (PR_1000365285)** — IP Authorized Managers behaves incorrectly with regard to telnet access.
 - **Auto-TFTP (PR_1000362661)** — When auto-TFTP is enabled, the switch crashes after displaying "Rebooting the System" after a "reload" command is issued from the CLI.
 - **CLI (PR_1000358129)** — The command line interface (CLI) becomes unresponsive after running RMON traps code.
 - **Crash (PR_1000368540)** — The switch may crash with a message similar to:

```
Software exception at parser.c:8012 -- in 'mSess2', task ID =  
0x90e10e0 -> ASSERT: failed.
```
 - **Crash (PR_1000360267)** — Removing a VLAN that is assigned as the unauthorized VID may cause the switch to crash with a message similar to:

```
Software exception at vls_dyn_reconfig.c:2640 -- in 'mSnmpCtrl',  
task ID = 0x170 -> ASSERT: failed.
```
 - **Enhancement (PR_1000351445)** — The "show tech transceiver" CLI command output now contains the HP part number and revision information for all transceivers on the switch.
 - **Hang (PR_1000365567)** — Switch may hang and ports may fail to link up.
 - **Hang (PR_1000346328)** — RMON alarms/events configuration files may become corrupt and prevent initialization, resulting in failure to boot.
-

- **RADIUS (PR_1000358525)** — Attributes that were overridden by RADIUS (CoS, Rate, and ACL) remain active if an authenticated user fails to send EAP-LOGOFF.
- **Source Port Filtering (PR_1000352851)** — Source Port Filtering on trunks does not work when both the source and destination are trunk ports, even though the switch accepts the configuration.

Release Q.10.03

Problems Resolved in Release Q.10.03 (not a general release)

- **802.1X (PR_1000378481)** — 802.1X authentication needs to be limited to 2 users per port.
- **CLI (PR_1000364628)** — The command output from "show ip rip peer" yields an improperly formatted peer IP address.
- **CLI/Config (PR_1000342824)** — Configuring a port for MDI will cause the port to act as MDI-X, and vice versa.
- **CLI/Config (PR_1000375830)** — When using the "no VLAN" command, the user is asked if they want to remove the VLAN. Answering "no" will result in the VLAN being removed anyway.
- **CLI/LLDP (PR_1000377191)** — Output from the CLI command, "show lldp info remote-device <port>" shows a blank field for the chassis ID.
- **Crash (PR_1000382962)** — Executing the CLI command, "sho int" on a mini-GBIC that is not linked, may cause the switch to crash with a message similar to:

```
Divide by Zero Error: IP=0x8017becc Task='mSess1' Task ID=0x834b19d0
fp:0x00000018 sp:0x834b0d20 ra:0x8017be18 sr:0x1000fc01 Division by
0 Crash at cli_opershow_action.c:1298.
```
- **Crash (PR_1000386489)** — The switch may crash with a message similar to:

```
Unaligned Access: Virtual Addr=0xa3e2dad7 IP=0x801f8234
Task='eDrvPoll' Task ID=0x81b02650 fp:0x81ecce90 sp:0x81b02538
ra:0x801f8209
```
- **Enhancement (PR_1000379804)** — Historical information about MAC addresses that have been moved has been added to the "show tech" command output.
- **Syslog (PR_1000379802)** — Forwarding of event log message to a configured syslog server is not disabled when a specific event log message has been disabled via MIB.
- **Web/RADIUS (PR_1000368520)** — Web Authentication does not authenticate clients due to a failure to send RADIUS requests to the configured server.

- **Web-UI (PR_1000373711)** — Attempting to access the Web UI of a stack member without being logged on as Manager returns a "404 Page Not Found" error.

Release Q.10.04

Problems Resolved in Release Q.10.04 (never released)

- **Auto MDIX (PR_1000355099)** — Forced mode auto-MDIX on 10/100 ports does not function.
- **CLI (PR_1000380660)** — The "show tech transceivers" CLI command displays the wrong message when inserting an "A" version transceiver into a switch that only supports "B" version transceivers. Also, "B" version CX4 transceivers show up as "A" and "A" version SR, LR, and ER transceivers show up as "B" versions.
- **CLI (PR_1000390385)** — The CLI help text for "span bpdu-protection-timeout" is incorrect; it erroneously displays the help text for "span hello-time".
- **CLI/Config (PR_1000377413)** — The CLI does not prevent an invalid configuration from being loaded. With this fix, configurations with excess IP Address QoS entries will result in an error message and the config file will not load.
- **CLI/config (PR_1000391119)** — Copying a configuration file to a switch with a BPDU protection time-out value set may produce an error similar to:

```
CCCCCline: 10007. 1200: Error setting configuration
```

- **CLI/LLDP (PR_1000377191)** — Output from the CLI command, "show lldp info remote-device <port>" shows a blank field for the chassis ID.
- **Crash (PR_1000357252)** — When authenticating with Web UI using a Radius server, the switch may crash with a message similar to:

```
TLB Miss: Virtual Addr=0x00211dc4 IP=0x00211dc4 Task='tHttpd' Task  
ID=0x83413db0 fp:0x00000000 sp:0x83413c69
```
- **Enhancement (PR_1000365862)** — This portion of the enhancement added the option of configuring ports that had been previously disabled by BPDU Protection to be automatically re-enabled.
- **Enhancement (PR_1000373226)** — Support was added for a future SFP transceiver.
- **GVRP (PR_1000385623)** — The switch does not process GVRP frames when the receiving port is tagged, so no VLANs are learned from that source.
- **Trunking (PR_1000238829)** — Trunks numbered trk10 and greater cause the output from the CLI command "show span" output to be misaligned.

Software Fixes in Release Q.10.03 - Q.10.05
Release Q.10.05

- **Web UI (PR_1000326265)** — Attempting to access the Web UI of a stack member hangs the browser.

Release Q.10.05

Problems Resolved in Release Q.10.05

- **Daylight savings (PR_1000364740)** — Due to the passage of the Energy Policy Act of 2005, Pub. L. no. 109-58, 119 Stat 594 (2005), starting in March 2007 daylight time in the United States will begin on the second Sunday in March and end on the first Sunday in November.



© 2007

Hewlett-Packard Development Company, LP.
The information contained herein is subject to
change without notice.

March 2007

Manual Part Number

5991-6274