

HP Color LaserJet Enterprise MFP M480f Series Firmware Readme

HP Color LaserJet Enterprise MFP M480f

Product Name(s):

- HP Color LaserJet Enterprise MFP M480f

Model Number(s): 3QA55A

This document contains information for the firmware revision number:

Firmware Datecode: 20241216

Firmware Revision: 2508402_000106

Fleet Bundle Version Designation: FutureSmart Bundle Version 5.8.1.2

Description

- What is included in the Firmware bundle?
- Who needs this firmware?
- Determining the current version level of your firmware

Enhancements and Fixes provided with this firmware revision

Enhancements and Fixes provided with the previous revision(s)

Installation Instructions

- Additional Information to know
- Using the Embedded Web Server
- Using the Walk up USB port
- Web Jetadmin

System Requirements

Technical Assistance

Customer Support

Internet

Additional Information

Legal Statements

- Trademark Notices
- OPEN-SOURCE SOFTWARE LICENSE AGREEMENTS (In English)
- License and Copyright

Description

This Readme file provides specific installation instructions and other information you should know before you perform a firmware update for your HP LaserJet Series printer or MFP. Installation instructions are provided for Single and Multiple Printer Updates.

This document provides specific update, installation and troubleshooting information. For additional information on the device features, refer to the online user guide found on the Windows Printing System Installer CD-ROM that came with your printer or at hp.com.

What is included in a Firmware bundle?

The HP LaserJet printer firmware update file available from the hp web site contains firmware for the printer, embedded JetDirect (if applicable), HP paper handling accessories used with the device in one convenient download file. When the Remote Firmware Upgrade file is sent to the HP LaserJet Printer or MFP firmware for the engine and all connected accessories are upgraded.

Who needs this firmware?

Similar to Hewlett Packard providing improved software for your HP LaserJet Printer or MFP, Hewlett Packard provides firmware updates for your printer periodically through its supported lifecycle. A firmware update may be necessary if it is determined that you may benefit from the resolution of any issue that is documented below. These updates are available on the HP support web site.

Determining the current version level of your firmware

To determine the current level of firmware installed on the device:

Go to the printer's or MFP's control panel.

1. Go to the printer's control panel.
2. Swipe left and select the **Reports** application.
3. Select the **Configuration/Status Pages** menu.
4. Select the **Configuration Page** option.
5. Select the **Print**.

On the printed Configuration page look in the section marked "Device Information" for the Firmware Datecode and Firmware Revision. The Firmware Datecode and Firmware Revision will look something like this:

Firmware Datecode: 20210128

Firmware Revision: 2501232_004613

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.1

IMPORTANT NOTE:

This firmware file requires an interactive update method. You CANNOT update these Product(s)/Model(s) using the traditional FTP, LPR or Port 9100 methods of upgrading. Please use one of the following methods listed below to update the firmware of this device.

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20241216

Firmware Revision: 2508402_000106

Fleet Bundle Version Designation: FutureSmart Bundle Version 5.8.1.2

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No new updates

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

FIXES:

Base:

- No new updates

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- Please check the HP Security Bulletin links for more information about security fixes included in this release.

Embedded JetDirect:

- No new updates

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	VERSION
Firmware Datecode	20241216
Firmware Revision	2508402_000106
Embedded JetDirect	JOL25080321
DC Controller Version	7.109
SCB	xxxxCA2340AR 1.0
Fax 700 Series	CSF.095.00.231129.04.0675,BSP.50240222
Fleet Release Designation	FutureSmart 5.8.1.2
MD5 checksum for .bdl file	9821ee86c9fd1560a6384a9b781cc711

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20241116

Firmware Revision: 2508385_053946

Fleet Bundle Version Designation: FutureSmart Bundle Version 5.8.1.1

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Supply settings have been added to the Backup/Restore process.
- Modifications to the German-Swiss keyboard layout to improve ease of use.

Digital Sending:

- Incoming faxes can be transferred to multiple email destinations.

Analog Fax:

- Updated the search capabilities within the fax address book to be more user-friendly.
- The "+" character is now available on the control panel interface for internet fax jobs.

Security/Authentication:

- No new updates

Embedded JetDirect:

- Added support for up to 32 DNS suffixes.

FIXES:

Base:

- Intermittent 49.38.03 error may occur when performing a Scan to Email job.
- Print sample or target files may fail to print when sent from the Custom Color Manager 2.1 application to a device.
- A 49.38.03 error may occur when printing certain customer generated PDF files.
- Certain types of direct PDF print jobs will appear to start processing and fails to print.
- A Postscript error may occur when printing specific PDF large file.
- Print jobs may fail to print when sent via IPP printing from a Chrome OS device.
- Longer than expected processing time may occur for PDF files produced by Microsoft Universal Print.
- Specific PDF files are not able to be processed directly by the printer.
- Direct PCL printing may prompt for the incorrect custom paper size.
- Added the ability to cancel copy jobs after an unattended error.

Digital Sending:

- A 48.05.03 Constraint error may occur followed by 49.38.07 crash when performing a scan to E-mail or scan to Network folder job.
- An SMTP gateway not responding message may occur when scanning and using IPv6, even though emails are successful.

Analog Fax:

- A fax communication error may occur while switching between analog and IP fax jobs.

Security/Authentication:

- Windows LDAP authentication may fail after a reboot or waking from sleep.
- A 45.08.02 error may occur after swiping HID proximity key.
- Email may fail to send when NTLMv2 is configured on SMTP.
- A longer than expected pause between jobs may occur when retrieving more than one password-encrypted stored job.
- Device is not able to use two Root CA Certificates with same name.

Embedded JetDirect:

- When IPv6 address is empty, signaling to UDP may not be successful.
- An 81.09.00 error may be observed while unregistering the device from web services in the Embedded Web Server.
- An 81.09.00 error may occur when selecting the wrong Cipher for authentication.
- The device may not send ARP at the end of DHCP ACK when communicating with a DHCP server.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	VERSION
Firmware Datecode	20241116
Firmware Revision	2508385_053946
Embedded JetDirect	JOL25080321
DC Controller Version	7.109
SCB	xxxxCA2340AR 1.0
Fax 700 Series	CSF.095.00.231129.04.0675,BSP.50240222
Fleet Release Designation	FutureSmart 5.8.1.1
MD5 checksum for .bdl file	460846a4094650588b1bb48d9b4fc688

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20240723

Firmware Revision: 2508048_049281

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.8

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added Vietnamese language support for the control panel.
- Incorrect job printing order may occur when a print job is interrupted for a Copy job.
- Added Basque language support for the control panel.

Digital Sending:

- Added support for Scan to OneDrive with Microsoft Sign In (Username and Password).
- Added support for Scan to SharePoint with Microsoft Sign In (Username and Password).

Analog Fax:

- No new updates

Security/Authentication:

- Added VPN support to the printer.

Embedded JetDirect:

- No new updates

FIXES:

Base:

- A false 30.03.45 error may occur when performing a forced shutdown.
- Line distortion and blocks may appear on scanned images with default scan resolution.
- A System Main Failed error may occur due to a memory allocation failure when processing print and copy jobs at the same time.

- A 49.00.FF error could be observed when printing JPG files from a USB thumbdrive.
- A 49.38.07 error may occur when switching the home screens during the sign in process of the device.
- A3 copies will always be counted as color when the Foreign Interface Harness (FIH) is enabled and using the automatically detect Color/BW setting.
- The printer page counts may be lost after receiving a 49.38.0D error.
- A 49.38.03 may be observed when printing with custom paper size settings.
- Some device settings could be lost due to a Disk Full Unhandled Exception.
- A timeout message may appear instead of successfully retrieving polled data when using SNMPv3.
- The device may have a blank display due to a failure in the Island of Data (IoD) module.
- A 45.08.01 USB initialization error may occur when authenticating with certain USB card readers.
- Some card readers intermittently fail to authenticate the user.
- The X of Y copy count text is translated incorrectly in Japanese within the Job Log menu.
- HP CAC Readers may become unresponsive when upgrading to FutureSmart 5.7.1.1.
- A 49.38.07 may be observed when printing an A4/Letterhead job with Alternate Letterhead Mode enabled.
- A "cCleanDocumentFeederRollers" message may be incorrectly recorded on the Event Log page.
- A PDF file may print a black background when it is supposed to be blank (paper white) using the Macintosh HP driver.
- The "Print List" text is translated incorrectly in Japanese within the Print from Job Storage menu.
- The system uptime is incorrectly displayed due to the time zone offset.
- Some PDF files may fail to print completely when submitted via Print From USB Drive or using the Print menu of the Embedded Web Server Information tab.
- Devices may randomly not establish communication to the Network Time Server.
- A User Interface hang may be encountered when transitioning to a third party kiosk application.
- Copy image quality improvements have been implemented.
- A 49.38.03 error may occur when an Elite Accounting License has expired after upgrading to 5.7 firmware.
- A 42.26.00 Insufficient memory error may occur when printing high resolution images through the Direct PDF path in the Embedded Webserver or Front Control Panel.
- SNMP OID npCfgIPConfigPrecedence (1.3.6.1.4.1.11.2.4.3.5.59) does not accept valid input.
- The Enter Key on the physical keyboard does not work when the virtual keyboard has been disabled.
- Devices using L1 solutions may experience a USB initialization error on startup.

- A pin print driver job may be removed from the print queue and will be marked with the job status reason of "job-password-wait", and the job will be marked as completed.

Digital Sending:

- Scan to SharePoint jobs may slow down and may cause a 44.16.0D after a few jobs.
- Distorted or missing images could result when performing a scan to USB or scan to network folder job using recycled media.
- User prompted for credentials during scan job when quickset specifies "Always use these credentials".
- A 49.DE.11 error can be observed when performing a native Scan to Folder job.
- Encrypted emails fail for case mismatch between the Active Directory mail attribute and the Subject Alternative Name (SAN) in the certificate.
- The device may not log the user out after the inactivity period has been reached in certain instances.
- A 49.38.07 error may occur if the recipient email address is entered directly into the TO field when both the local and the LDAP address book are active on the printer.

Analog Fax:

- Unable to send or receive faxes due to Private Branch Exchange (PBX) mode not working properly.
- Lanfax notifications do not work when a "-" (dash) is included in the destination phone number.
- Failed faxes are incorrectly reported as Stored on Fax Activity Log.
- Canceled Faxes are incorrectly reported as Stored on Fax Activity Log.

Security/Authentication:

- Firewall rules are still allowing access to the Embedded Web Server.
- HTTPS jobs over TLS 1.3 may fail to send even after successfully negotiating the initial connection.
- Update within code to account for mismatch between syslog and security log
- Networking > Security Settings > Status page in the Embedded Web Server always shows the Firewall as "Disabled" even when it is enabled.
- "Unexpected LDAP address book error" may occur when using the network address book feature.
- An intermittent Kerberos authentication failure may be observed.
- Session Setup Response randomly contains error:
STATUS_USER_SESSION_DELETED (0xc0000203)

Embedded JetDirect:

- Device answers ping from server (server-side conflict resolution) during DHCP DORA process causing multiple IP addresses to be consumed.
- Device may get stuck in a DHCP loop after a power failure.
- Not able to change certain values within the wireless configuration of the device when configuring the device through the Web JetAdmin tool.
- Ports 7627, 80, and 443 can sometimes stop responding a few hours to a few days following bootup.
- DHCP response with option 119 may cause connectivity issues with accessing the Embedded Web Server and printing.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20240723
Firmware Revision	2508048_049281
Embedded JetDirect	JOL25080030
DC Controller Version	7.109
SCB	xxxxCA2340AR 1.0
Fax 700 Series	CSF.095.00.231129.04.0675,BSP.50240222
HP Fleet Release Designation	FutureSmart 5.8
MD5 checksum for .bdl file	c833ea39c1869fb9c001be8ea837f3f9

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20240129

Firmware Revision: 2507252_046159

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.7.1.1

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added Vietnamese language support for the control panel.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

FIXES:

Base:

- Some Double-Byte font characters may not print correctly when printing from SAP.
- A 49.38.07 Error occurs when a CF259XR toner cartridge is installed in an M430 engine.
- A device crash occurs due to memory corruption when an Inepro card reader is attached and card reader data is read.
- The X of Y copy count text is translated incorrectly in Japanese within the Job Log menu.
- Printing hangs while processing some password-protected, stored print jobs until the printer is rebooted.
- Random print jobs disappear and never print after the device has been in sleep mode for several days. Copy and Scan job work.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- LDAPs Contact List fails when SPNEGO authentication is selected.
- Smartcard authentication does not work for all users on Series 400 and newer products.

Embedded JetDirect:

- Ports 7627, 80, and 443 can sometimes stop responding a few hours to a few days following bootup.
- Embedded Web Server may become unresponsive when the TLS is limited to 1.2 and higher after installing a CA-signed ID certificate.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20240129
Firmware Revision	2507252_046159
Embedded JetDirect	JOL25077219
DC Controller Version	7.109
SCB	xxxxCA2317AR 1.0
Fax 700 Series	CSF.093.00.230706.04.0675,BSP.50230707
HP Fleet Release Designation	FutureSmart 5.7.1.1
MD5 checksum for .bdl file	0b9315bcf2c41ddcbafcdc6f2e041e7d

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20230809

Firmware Revision: 2507050_043119

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.7

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No new updates

Digital Sending:

- Added support to be able to Export/Import of all types of Quicksets that may have Authentication requirements.

Analog Fax:

- No new updates

Security/Authentication:

- Added the ability to contact more than one LDAP server if the primary server cannot be reached.

Embedded JetDirect:

- No new updates

FIXES:

Base:

- Black lines which appear to look like a bar code may print on the side of an image within certain files.
- A prompt for SNMP credentials may occur in Web JetAdmin when configuring certain settings due to an SNMP response time of more than .5 seconds when the device is in deep sleep.
- Third party card reader firmware update tool does not work properly.
- The Image Overlay feature within the copy menu is rotated and printed 180 degrees from normal.
- Only half of radio button is displayed on the IP address range setting screen in the Embedded Web Server (EWS).
- A secondary job in the print queue may not print out after a copy job from the ADF has finished printing.
- Paper feed may not be pulling media when Automatically Select Tray is being used with Expert Copy.
- An intermittent 30.03.30 errors may occur after upgrading to FutureSmart 5.5 firmware.
- The control panel user interface may slow down as more quicksets are added.
- A 49.4A.0A and 49.38.07 error may be seen when printing specific Postscript files.
- A Client Error: Document Format Not Supported may be seen when the printer is responding to an IPP request and there are more than 80 quicksets loaded.
- A communication failure may occur when the device is connected to a PC using a USB cable.
- The Friday abbreviation is localized incorrectly in the German language within the Energy Settings menu.
- Incorrect printed page order may occur when printing from Tray 1 with specific jobs.

Digital Sending:

- A document is incorrectly detected as officio when an A3 size media is placed in the Automatic Document Feeder (ADF).

Analog Fax:

- Fax numbers are not blocked if there are space between the numbers.
- Incoming fax failures may occur while using a MFP fax device with Cisco ATA 190.

Security/Authentication:

- Wild card certificates not functioning properly.

Embedded JetDirect:

- Embedded Web Server hangs may occur after Syslog is configured for the TLS protocol.
- Intermediate CA certificates not being shared during TLS handshake process.
- DHCP configuration being released after successful 802.1x authentication.
- Czech translation is incorrect on the control panel for the DHCP Release button and the firmware Rollback button.
- Hostname for scan-to-folder jobs not getting resolved when network does not have local DNS support.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20230809
Firmware Revision	2507050_043119
Embedded JetDirect	JOL25077011
DC Controller Version	7.109
SCB	xxxxCA2325BR 1.0
Fax 700 Series	CSF.093.00.230706.04.0675,BSP.50230707
HP Fleet Release Designation	FutureSmart 5.7
MD5 checksum for .bdl file	218b08b584aeb9d6102d74c0e078f7aa

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20230521

Firmware Revision: 2506649_040411

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.6.0.2

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Enable print job encryption and signing in the UPD using user public and private key from HP US Government smart card. Also enable print job validation and decryption using a US Government smart card solution.

Digital Sending:

- Improved performance when importing a bulk encrypted address book.

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

FIXES:

Base:

- Hostname for scan-to-folder jobs not getting resolved when network does not have local DNS support.
- The control panel user interface may slow down as more quicksets are added.
- The Job Accounting Data in Device User Statistics log may be incorrect when sending stored jobs with an unmatched User Access Code in UPD or SUPD print driver.
- The Announcement Agent no longer works after performing a "Reset Firmware" from within the Embedded Web Server.

Digital Sending:

- Authentication fails when umlaut characters are used in scan-to-folder password.

Analog Fax:

- No new updates

Security/Authentication:

- 802.1x authentication fails immediately after the printer sends its certificate.
- Occasionally, a "STATUS_USER_SESSION_DELETED" error will be returned from a Microsoft file server in response to an SMB Session Setup Request from an HP MFP device.

Embedded JetDirect:

- Hostname for scan-to-folder jobs not getting resolved when network does not have local DNS support.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20230521
Firmware Revision	2506649_040411
Embedded JetDirect	JOL25060606
DC Controller Version	7.109
SCB	xxxxCA2246AR 1.0
Fax 700 Series	CSF.088.00.220929.04.0675,BSP.50220920
HP Fleet Release Designation	FutureSmart 5.6.0.2
MD5 checksum for .bdl file	d7bdf205ed44ed23e9ea8ef312a1af07

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20230401

Firmware Revision: 2506421_038575

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.6.0.1

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Introduced new Workpath requirements and features.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- Added support for the new USB keyboard part# 266C9AA.

FIXES:

Base:

- A certificate error will occur when using the Oxpds solution with an older certificate.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20230401
Firmware Revision	2506421_038575
Embedded JetDirect	JOL25060023
DC Controller Version	7.109

SCB	xxxxCA2247CR 1.0
Fax 700 Series	Version Missing
HP Fleet Release Designation	FutureSmart 5.6.0.1
MD5 checksum for .bdl file	88a067800298920218d550522a31a462

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20230207

Firmware Revision: 2506116_037345

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.6

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added the ability to Enable and Disable the Server Message Block (SMB) versions SMBv1, SMBv2, and SMBv3.
- Add discovery information to Embedded VPN and the ability to disable Embedded VPN.
- Added administrator controls for the clear event log command via Access Control section of device security to ensure that event logs are not erased as part of a service routine.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- Added support for HMAC-SHA2 during negotiation of a secure session.

Embedded JetDirect:

- No new updates

FIXES:

Base:

- The wrong output size of A6 is saved when the original scan size is A4 when scanning to a USB thumbdrive with a .jpg file format.
- Icons in the upper left corner of the control panel may be overlapping when using a Workpath application.
- The Announcement Agent no longer works after performing a "Reset Firmware" from within the Embedded Web Server.
- An SNMP GET request fails to respond when SET community name is set and read/write access is enabled.
- A delay in printing may occur with an iPad or iPhone when using the AirPrint protocol.
- A 49.38.03 error may occur when signing in using a badge and then selecting an application on the control panel before the sign-in completed.
- A 49.38.07 error may occur in certain instances when printing any file after loading a custom color table.
- Custom pre-pend and append strings not working in LPD custom queue setup.
- The SNMP default Community Name "public" is not working on new or newly reset devices.
- A 49.38.07 error may occur when setting up fax storage and printing.
- An OpenWnn error message appears on the control panel when using a Workpath application when the control panel is set to the Japanese language.
- An incorrect message is displayed when performing an Embedded Web Server Export operation.
- Expert Copy help content is not matching the actual functionality of the menu.
- Blank pages may be printed on certain files when sending a Direct PDF print job.
- The Card Identification number is missing alphanumeric digits with the Embedded Badge Authentication using proximity card reader X3D03A compared to HP Card Reader Configuration Utility.
- A 49.38.07 error may occur when printing a C5 envelope.
- A 49.4A.04 error may occur when printing a PDF file with the MacOS AirPrint driver.

Digital Sending:

- Network Contact list not responding until most of the name is entered when used from the Control Panel.
- A 451 response error code will occur due to the SSRF countermeasure sending the incorrect forgery username format.
- Intermittent send-to-email failures may occur due to Gmail server timeouts.

Analog Fax:

- A 99.07.22 error may occur when the formatter is trying to communicate with the fax modem or when trying to upgrade the fax firmware and it fails.

Security/Authentication:

- Unable to read or set ePrint Settings via Web Jetamin.

Embedded JetDirect:

- HP Web Jetadmin cannot read or set the ePrint Settings on FutureSmart 5 devices.
- The device may fail to wake up from deep sleep and re-authenticate when using a secure 802.1x network.
- A PrintUri status may return a "job-completed-successfully" message even though nothing has printed.
- 802.1x authentication fails when TLS 1.0 is disabled.
- JetDirect config page can be misleading or incorrect when Ethernet interface is not connected.
- Unable to manually enter an IP address when the Control Panel language is set to French.
- 81.09.00 errors may occur under certain network environment and circumstances.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20230207
Firmware Revision	2506116_037345
Embedded JetDirect	JOL25060021
DC Controller Version	7.109
SCB	xxxxCA2246AR 1.0
Fax 700 Series	CSF.088.00.220929.04.0675,BSP.50220920
HP Fleet Release Designation	FutureSmart 5.6
MD5 checksum for .bdl file	790c2d98c36e35774f0263805eef2dc1

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20221111

Firmware Revision: 2505701_000855

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.5.0.3

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No new updates

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

FIXES:

Base:

- An unformatted text job sent over the USB interface may cause a long 5 minute timeout and an error requiring the user to press the "OK" button to complete the print job.
- An "Unexpected Error has occurred" message may appear within the Embedded Web Server when trying to change the Custom Tray Mapping setting.
- The control panel may become unresponsive and hang when the device is left idle for a long time after a power cycle.
- Macros will not stay resident on a USB storage device after rebooting the printer.
- Print jobs are not getting processed by the I/O Filter if a PCL print job is not encapsulated with PCL.
- OXPd Solutions that rely on POST methods while using the user interface will now correctly re-post the body of the request (e.g. URL form encoded data) if redirected with a 307 response from the web server.
- The SNMP OID to enable the legacy TLS renegotiation handshake does not work.
- User sign-in attempts with badges may be ignored if using some third party and HP branded solutions. This occurs if those solutions are using the OXPd Callback

Operation SDK and attempting to reserve authorization contexts without admin credentials.

- A "Device User" is not able to add contacts to a Group and will only be able to add individual contacts when accessing the Embedded Web Server's Access Controls.
- Fax speed dial data may not import onto a device if there are incorrect Japanese characters on the web page or Embedded Web Server.
- Notification jobs are printed in mono but counted as color when a thumbnail is included.
- The Copy button at the bottom of the control panel home screen may randomly be grayed out.

Digital Sending:

- Scanning from the flatbed may produce a PDF file with a gray background after upgrade to the FutureSmart 5.5 firmware bundle.
- 44.01.3F and 44.01.46 events are seen intermittently in the event log.
- Incorrect page orientation may occur while scanning from the flatbed when using the HP Universal Scan Solution.

Analog Fax:

- A 99.07.22 error may occur when the formatter is trying to communicate with the fax modem or when trying to upgrade the fax firmware and it fails.

Security/Authentication:

- No new updates

Embedded JetDirect:

- Device loses the manual network configuration settings during a power cycle if not connected to a network.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20221111
Firmware Revision	2505701_000855
Embedded JetDirect	JOL25050254
DC Controller Version	7.109
SCB	xxxxCA2229AR 1.0
Fax 700 Series	Version Missing
HP Fleet Release Designation	FutureSmart 5.5.0.3
MD5 checksum for .bdl file	572b2460614c1f27ddd422fc8d5d6aca

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20220602

Firmware Revision: 2505192_030566

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.5

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added the ability to schedule daily, weekly and monthly email summarizing device user statistics for Serverless Job Accounting / Local Quota solution.
- Added the "Drum Data Erase" report to overwrite any information that may remain on the image drum.
- Added ability to schedule a periodically sent email that contains the exported Device User Statistics Log. Note that the Device User Statistics Log is different from the Device Usage Log which is typically what is used to collect device meters/counters.

Digital Sending:

- Added the ability to reduce the Scan to Email file size by allowing user to select the "Quality and File Size" setting.

Analog Fax:

- No new updates

Security/Authentication:

- Added TLS 1.3 support along with the TLS_AES_256_GCM_SHA384, TLS_AES_128_GCM_SHA256, and TLS_AES_128_CCM_SHA256 ciphers. Note: Fleet tool support will be available in HPSM 3.9 and WJA 10.5SR2.

Embedded JetDirect:

- Added configuration options for disabling ports 80, 7627 and 443 without using the Firewall.

FIXES:

Base:

- The SNMP OID .1.3.6.1.4.1.11.2.3.9.4.2.1.1.1.65.0 (power state) is not working.
- The scanning option is not available when using HP Advance Secure Scan.
- The "Cycle Counts" value has changed to "Service Counts" with in the Service menu before opting into new counting method for Cycle Counts.
- Slow Performance may occur with the copy application after upgrade firmware to FutureSmart 5.4.
- Slow Performance may occur with copy jobs after upgrade firmware to FutureSmart 5.4.
- Slow performance may occur when adding Scan Quicksets via the Embedded Web Server.
- PCL5 tray commands no longer work for specific jobs after upgrading to 25.3.
- jpg images may print in unexpected orientation when printing from Photos application via AirPrint.
- Incorrect Polish translation for "Done" is seen within the copy menu.
- EWS will slow down and may cause the printer to hang after scheduling several wake events.
- False reporting in the event log may occur for a Workpath error crash.
- Email alerts for Cartridge status are not getting sent after FW upgrade.
- Device may become unresponsive during HP Advance Scanning.
- An automatic trigger was created for the FIH (Foreign Interface Harness) enablement with non-MICR sensor.
- A crash on bootup may occur when a USB card reader and 3rd party solution is installed.
- A processing job hang may occur when printing one or two pages just after installing a used toner cartridge.
- A YSoft card reader may not function on certain models.
- A 30.01.44 Scanner Failure may occur while performing many back to back scan jobs.

Digital Sending:

- The Job icon stays displayed indefinitely while using auto filled stamps with special characters in certain languages.
- Scanning to an FTP sub-folder may fail.
- Incorrect scan orientation may occur when using HP Scan Twain from the flatbed.

Analog Fax:

- A discrepancy counting Fax 'Monochrome' vs. 'Total' may occur on the page counts/equivalent impressions.
- The Windows domain field under the Fax Archive to Network folder will accept any input characters without validating them.

Security/Authentication:

- Corrected issue for Digicert root CA certs with SHA-384 hashing algorithm
- Addressed the frequent of the 33.05.52 Intrusion Detection errors which began after upgrade to firmware 5.2.0.2, 5.3 or 5.4.

Embedded JetDirect:

- IPP/IPPS improper status may occur after receiving a PS job with a syntax error.
- The Jetdirect 3100w may disconnect from network which requires a reboot of the printer to recover.
- Unable to enter a valid IP address range for an IPsec custom template.
- The SNMP OID to enable legacy TLS renegotiation handshake does not work.
- A 81.09.00 error may occur during sleep mode or the device may hang in "Initializing" when a long hostname is used.
- A 81.09.00 error may occur after connecting to a particular VLAN.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20220602
Firmware Revision	2505192_030566
Embedded JetDirect	JOL25050028
DC Controller Version	7.109
SCB	xxxxCA2150AR 1.0
Fax 700 Series	CSF.080.00.211021.04.0674,BSP.50210722
HP Fleet Release Designation	FutureSmart 5.5
MD5 checksum for .bdl file	317244e370a3f08e6d23c3f2010aee3

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20220213

Firmware Revision: 2504171_023869

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.4

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>
To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added ability to schedule daily, weekly and monthly automatic quota resets or email quota reports for Serverless Job Accounting / Local Quota.
- Added preset percentage values to the Reduce/Enlarge copy menu to allow scaling between common paper sizes.
- Added an Enable USB pop up window on the control panel when the USB Device port is disabled and a USB cable has been attached from the printer to a PC for the first time.
- Added the capability for multiple stamps to be located in the same stamp region.
- Added support for printing JPG and PNG file formats along with adding Print Options such as copies, color mode, duplex, paper source, auto fit when printing from a USB thumbdrive.
- Additional information has been added to the instant on message to provide information indicating if it's a periodic instant on message (every 12 hours) or an instant on message due to other reasons (for example device reboot). This additional information can be used by applications which can consume instant-on messages, such as HP Security Manager 3.7 or higher, in order to determine if an action by the receiving application is required.
- The Generate Debug data menu is no longer available since it will now be generated by default and will be a part of the Retrieve Diagnostic log files. A separate action to generate this file is no longer required.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- Added FIPS mode.
- Added support for ECDSA-based CA and identity certificates.
- Added new syslog messages for enabling/disabling FIPS mode & FIPS compliance.
- Integration of FIPS 140-2 validated wolfCrypt module.

Embedded JetDirect:

- Additional information has been added to the instant on message to provide information indicating if it's a periodic instant on message (every 12 hours) or an instant on message due to other reasons (for example device reboot). This additional information can be used by applications which can consume instant-on messages, such as HP Security Manager 3.7 or higher, in order to determine if an action by the receiving application is required.

FIXES:

Base:

- A blank screen on the control panel may occur with only an arrow cursor when using HP Advance.
- A 49.38.18 error may occur when accessing the Support Tools menu if an email domain is entered in the "Allowed Email Domains" list within Embedded Web Server Security tab (Email Domain Restriction).
- A freeze/hang may occur when a Foreign Interface Harness (FIH) solution is connected to the device.
- A PostScript Error: "Typecheck" may occur when printing certain PDF files.
- A 49.DE.15 error may occur after running for about 2 hours when attempting to load a kiosk application.
- Excess System Logging (Syslog) which is enabled in the Embedded Web Server Networking tab may occur while printer is in sleep mode.
- The OID Fax count value does not match the Usage Page fax count.
- The first DHCP transaction after a reboot does not contain complete information.
- Some Direct PDF print jobs may disappear and not print when printing from the Embedded Web Server PRINT feature.
- An "Error Connecting to Device" message may occur when connecting to card reader Y7C05A to a device.
- Print jobs may hang when using 1200 dpi (Fine Lines) driver settings or with certain type of files within different applications after upgrading to FutureSmart 5.3.
- All jobs are logged in the "Others" account group when using embedded badge authentication for local device accounts, and Serverless Job Accounting / Local Quota solution.
- The device may reboot intermittently and hang during initialization when upgrading from FutureSmart 5.2.x to FutureSmart 5.3 firmware.
- PDF parsing error may occur when performing a Direct to PDF print job.
- Square box characters are printed instead of actual characters when printing via ePrint.

Digital Sending:

- A "31.13.02 Jam in Document Feeder" error may occur after power cycle or upgrading firmware if the ADF feeder is open.
- A 49.38.13 error may occur when performing a Send to Folder job and the Hostname is resolved to multiple IP Addresses.
- The digital output is clipped and missing while scanning at 300dpi using the flatbed.
- Poor quality on scanned output may occur when using 400 dpi or higher scanned resolution.

Analog Fax:

- The OID Fax count value does not match the Usage Page fax count.

Security/Authentication:

- LDAP admin users using OXPd are not receiving admin permissions.
- Common Criteria Certification enhanced logging is disabled by loss of connection to the timeserver.

Embedded JetDirect:

- A 81.09.00 error may occur while performing an A5 copy job.
- A 81.09.00 error may occur when performing a copy job with specific settings.
- A 400 bad request error may occur when creating a new IPsec/Firewall rule in the Embedded Web Server when the localized language is set to Spanish.
- The first DHCP transaction after a reboot does not contain complete information.
- Excess System Logging (Syslog) which is enabled in the Embedded Web Server Networking tab may occur while printer is in sleep mode.
- The Control Panel may become unresponsive and/or the network may intermittently disconnect due to energy requirement changes when a Bluetooth Low Energy (BLE) or Wireless accessory is connected.
- Updated the network stack.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20220213
Firmware Revision	2504171_023869
Embedded JetDirect	JOL25040029
DC Controller Version	7.109
SCB	xxxxCA2150BR 1.0
Fax 700 Series	CSF.080.00.211021.04.0674,BSP.50210722
HP Fleet Release Designation	FutureSmart 5.4
MD5 checksum for .bdl file	d10007696118fb91db0afb279863322f

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20211204

Firmware Revision: 2503242_000333

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.3.0.1

For information on HP Security Bulletins addressed by firmware releases, please visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No new updates

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- No new updates

Embedded JetDirect:

- No new updates

FIXES:

Base:

- A 49.38.07 error may occur when using any accessory to authenticate an end user.
- Remove certificate pinning, to prevent conflicts with Transparent Proxy use and Web Services communication.
- A black image is printed when using the Direct PDF print path.

Digital Sending:

- No new updates

Analog Fax:

- No new updates

Security/Authentication:

- Unable to verify certificates with expiration date exceeding 03:14:07 UTC on 19 January 2038.

Embedded JetDirect:

- No new updates

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20211204
Firmware Revision	2503242_000333
Embedded JetDirect	JOL25030046
DC Controller Version	7.109
SCB	xxxxCA2145CR 1.0
Fax 700 Series	CSF.079.00.210907.04.0674,BSP.50210722
HP Fleet Release Designation	FutureSmart 5.3.0.1
MD5 checksum for .bdl file	fa3683856d131fbd689b710f94768041

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20211013

Firmware Revision: 2503219_016685

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.3

For information on HP Security Bulletins addressed by firmware releases, please

visit: <https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email,

visit: <https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Added the Tray Protection feature to prevent a tray from being automatically selected.
- Added the ability to select Tray Priority order.
- Added the ability to enable Embedded Badge Authentication to sign-in to the device.
- Added the ability to Import/Export Embedded Badge Authentication Card registration list and security settings.
- Number of pages scanned and printed for copy Jobs are now provided in the Control Panel's Message Center Job Details screen.

Digital Sending:

- Added SMTP and email validation to be configurable on the control panel.

Analog Fax:

- No new updates

Security/Authentication:

- Increased the Embedded Web Server password length to support up to 32 characters for security purposes.

Embedded JetDirect:

- No new updates

FIXES:

Base:

- The combined 49.38.07 and 49.38.0C errors may occur on a device eventually leading to a permanent 49.38.0C error due to unrecoverable hard drive corruption with the following Issue Signature.
0049380Ce3395f8981ef2c74c447bb92e1ffdb42This firmware release will improve the long-term reliability for the installed hard drive and will help reduce the chance of encountering this issue in the future. This firmware release will not help with hard drives already experiencing these specific errors.
- Some PDF files pause frequently when printing with PCL6. Small improvements have been made in this area.
- Incorrect translation strings may be observed for Paper Jam messaging on the control panel of a device set to Japanese language.
- A 49.00.FF error may occur when printing certain PDF files.

- IPP/IPPS issues: long pauses between jobs, missing jobs/pages
- Print job does not complete when printing certain PS jobs.
- A Postscript error may be seen when printing specific Postscript jobs.
- Copy jobs submitted through Copy Kiosk applications are cancelled when the user logs out.
- The error message, "An unknown error has occurred, which has already been logged.
Sorry for the inconvenience." may appear in the device's Embedded Web Server Local Quota Configuration page if a Local Device User Account name includes a special character.
- Incorrect translation strings may be observed for "Original Size" on control panel menus on devices configured for Japanese language.
- Incorrect translation strings may be observed for "Skew Correction" and "Calibrate Deskew" configuration settings on devices configured for Japanese language.
- A printURI job may get terminated when a TCP/IP Idle timeout occurs.
- A 49.38.0C error may occur after receiving a lot of LDAP or FAX related errors.
- A hung client and loss of user data may occur due to missed acknowledgement from the LPD daemon while the printer is in a jam condition.
- A SureStart error may occur when performing a direct to PDF print job or printing certain PDF files from the Macintosh AirPrint driver.
- HTTP access to the device fails when Syslog configured for a bogus TCP server
- A 42.26.00 error may occur when printing certain PDFs.
- A device may become unresponsive and display the message "Damaged data detected by device and needs to be restarted. Stored User data might need to be re-entered".
- The "Roller cleaning is recommended" warning message is not able to be cleared from the control panel.
- The button description on the control panel may overlap an adjacent button description.
- Certain Postscript jobs will partially print and then report an error.
- A 49.4A.04 or 49.38.03 error may occur when performing a Direct to PDF print job.
- Incorrect language translations in Portuguese can be found in the Copy, Digital Sending and Help menus.
- A 49.38.07 or 49.38.18 error may occur when accessing the Support Tools menu if an email domain is entered in the "Allowed Email Domains" list within Embedded Web Server Security tab (Email Domain Restriction).
- The OID status lists the printer as "Exiting Sleep mode" when printing or at the Ready state.
- A 49.4A.04 error may occur when printing certain PDFs.
- The prtMarkerSuppliesEntry1.17 public OID (Toner Collection Unit) is displaying the incorrect value.
- A line at the bottom of the control panel screen may appear when Kofax/SafeCom authorization is used.

- A transparent application icon on the control panel is not displaying correct.
- You may see a brief flash of the application page while performing a multipart scan job. Interaction with the application during this time could have unpredictable side effects.
- An "Operation is not supported" error may occur when Workpath apps are re-arranged using the Embedded Web Server Home Screen Customization menu.
- The SNMP OID 1.3.6.1.4.1.11.2.4.3.7.70.0 for legacy handshake are not supported.
- A 49.38.07 error may occur when printing SAP jobs after performing a firmware upgrade.
- A disconnect in the established external connection may occur due to a previous change in the XIP module.
- An intermittent disconnect may occur that is attributed to communication issues while using a Workpath Application and connected to cloud services.

Digital Sending:

- Scan jobs may fail when the Misfeed Detection Mode is ON and a user navigates to the home screen after the scan job is initiated.

Analog Fax:

- No new updates

Security/Authentication:

- Permission is denied when signing into the Embedded Web Server with domain user and third-party solutions.
- Output may be in grayscale when signed in with the service pin when an OXPd authentication and authorization agents or any third party OXPd or embedded solutions are installed.
- Support for USAccess Smart Cards are not working.
- Failure to bind with cloud-based LDAP server which requires the basedn to be specified by "UID=xxxx" instead of "CN=xxxx"
- The Microsoft KB5004238 update will cause all smartcard authentications to fail.

Embedded JetDirect:

- The Wireless Hostname is not retained when configured using the Control Panel.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
Firmware Datecode	20211013
Firmware Revision	2503219_016685

Embedded JetDirect	JOL25030036
DC Controller Version	7.109
SCB	xxxxCA2135AR 1.0
CPB	6.094g
Fax 700 Series	CSF.079.00.210907.040.0674,BSP.50210722
HP Fleet Release Designation	FutureSmart 5.3
MD5 checksum for .bdl file	64577ed28fe56e2d9855454e648a2905

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20210721

Firmware Revision: 2502507_000081

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.2.0.2

For information on HP Security Bulletins addressed by firmware releases, please visit:

<https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit:

<https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Provides support to the new Device Discovery feature in HP Command Center, which permits a device to be discovered and onboarded from a primary device as a secondary listener via WS Discovery or Device Announcement Agent.
Note: Device must be compatible to install any available solutions after onboarding.

Digital Sending:

- No New Updates

Analog Fax:

- No New Updates

Security/Authentication:

- No New Updates

Embedded JetDirect:

- No New Updates

FIXES:

Base:

- No New Updates

Digital Sending:

- A 49.38.1B error is seen randomly when performing Send to Network folder jobs.

Analog Fax:

- No New Updates

Security/Authentication:

- An authentication failure will occur due to the URI (Uniform Resource Indicator) that is sent from the web request creator is partial rather than absolute.

Embedded JetDirect:

- No New Updates

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
HP Color LaserJet Enterprise MFP M480f	Firmware Datecode: 20210721 Firmware Revision: 2502507_000081
Embedded JetDirect:	JOL25020202
DC Controller:	7.109
HP Fleet Bundle Version Designation	Original Release FutureSmart 5.2.0.2
MD5 checksum for .bdl file	fb37a9f3a01c41d74f454772e9cda638

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20210331

Firmware Revision: 2502087_007702

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.2

For information on HP Security Bulletins addressed by firmware releases, please visit:

<https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit:

<https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- Additional Syslog auditing capabilities have been added to capture changes to the security posture related firmware settings.

Digital Sending:

- No New Updates

Analog Fax:

- No New Updates

Security/Authentication:

- Added limited EC cipher support.

Embedded JetDirect:

- No New Updates

FIXES:

Base:

- The files and directories are visible on a USB thumb drive which is intended to be used only for an installed solution.

- Some device configuration strings are incorrectly translated for the Portuguese language.
- A 64.03.04 error is seen when additional RAM is removed on a device where workpath is enabled.
- Some PDFs with specific settings are not printed correctly.
- Hex keyboard will not load with solutions.
- You may see the (mono) Engine Cycle count on the configuration page increment when printing high quality grayscale pages. Please remember that Engine Cycle counts should not be used for billing purposes.
- Certain PDFs do not print during Direct PDF printing.
- The time stamp in the printed Job log does not change to PM at Noon.
- A 44.16.06 error may occur when scanning to SharePoint and using credentials containing a special character (&"").
- The header and footer data are not printed correctly in certain documents.
- Certain PDFs printed from iOS devices do not print.
- Some device configuration strings are incorrectly translated for Portuguese language.
- Some settings are not restored correctly during Backup and Restore operation.
- Incorrect text string for "Darkness" for Japanese language, within device configuration options in Copy / Scan menus.
- A 49.38.13 error may occur when many PCL 5 print jobs are sent to a device in a short period of time.
- The wrong expiration date is displayed in the Embedded Web Server for Intermediate CA Certificates.
- The "Color Engine Cycles" count on the configuration page does not increment for color copies. Please remember that Engine Cycle counts should not be used for billing purposes.
- 49.38.07 error after loading Skip Disk load with a solution.
- A user may see incorrect data in third party applications after a reset event.
- Not all buttons respond to user interaction in some applications.
- Pull Printing may not work when a USB attached WiFi accessory is used for network access.

Digital Sending:

- Certificate caching issues for scanning to email with encryption.
- A scan job failure occurs when selecting the File Numbering Format _XX_of_YY when in the Japanese language.
- Vertical streaks may occur on scanned images.

Analog Fax:

- No New Updates

Security/Authentication:

- LDAP query fails when the server times out waiting for initial data.
- A 81.09.00, 99.05.56 , or 30.01.41 error may occur when the hostname + domain name (FQDN) is greater than 64 characters long.
- The network folder credential form is not filled out when a Smartcard user is authenticated with the Celiveo application.
- TLS version selected gets out of sync with TLS version used to negotiate a secure connection when using LDAP Contact List.
- Self-Signed ID and CA certificates are regenerating without cause after a reboot.
- Third party solutions created in 2021 will not be able to load on the device through the solution installer page.

Embedded JetDirect:

- A "USB hubs cannot be attached in series. Remove extra hubs." error may appear on the control panel when plugging in a JD3100w to the HIP pocket using a short cable.
- The Gateway address is missing digits in the last octet when the configuration page is viewed on the control panel and language is set to Japanese.
- Device may hang and become unresponsive when connected to a Gigabit network.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
HP Color LaserJet Enterprise MFP M480f	Firmware Datecode: 20210331 Firmware Revision: 2502087_007702
Embedded JetDirect:	JOL25020020
DC Controller:	7.109
HP Fleet Bundle Version Designation	Original Release FutureSmart 5.2
MD5 checksum for .bdl file	d873ab533b4c5393d674edf6f1b29a55

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20210223

Firmware Revision: 2501517_000125

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.1.0.1

For information on HP Security Bulletins addressed by firmware releases, please visit:

<https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit:

<https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No New Updates

Digital Sending:

- No New Updates

Analog Fax:

- No New Updates

Security/Authentication:

- No New Updates

Embedded JetDirect:

- No New Updates

FIXES:

Base:

- No New Updates

Digital Sending:

- Vertical streaks may occur on scanned images.

Analog Fax:

- No New Updates

Security/Authentication:

- No New Updates

Embedded JetDirect:

- Device may hang and become unresponsive when connected to a Gigabit network.

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
HP Color LaserJet Enterprise MFP M480f	Firmware Datecode: 20210223 Firmware Revision: 2501517_000125
Embedded JetDirect:	JOL25010027
DC Controller:	7.108
HP Fleet Bundle Version Designation	Original Release FutureSmart 5.1.0.1
MD5 checksum for .bdl file	8b563e52adf353af8a3aa50b360371c3

Previous releases are accumulative in current release and fixes are below.

Enhancements and Fixes provided with this Firmware revision

The following new functionality or features are provided by this firmware release:

Firmware Datecode: 20210128

Firmware Revision: 2501232_004613

HP Fleet Bundle Version Designation: FutureSmart Bundle Version 5.1

For information on HP Security Bulletins addressed by firmware releases, please visit:

<https://support.hp.com/security-bulletins>

To initiate a subscription to receive future HP Security Bulletin alerts via email, visit:

<https://www.hp.com/go/alerts>

ENHANCEMENT:

Base:

- No New Updates -- Original Release

Digital Sending:

- No New Updates -- Original Release

Analog Fax:

- No New Updates -- Original Release

Security/Authentication:

- No New Updates -- Original Release

Embedded JetDirect:

- No New Updates -- Original Release

FIXES:

Base:

- No New Updates -- Original Release

Digital Sending:

- No New Updates -- Original Release

Analog Fax:

- No New Updates -- Original Release

Security/Authentication:

- No New Updates -- Original Release

Embedded JetDirect:

- No New Updates -- Original Release

Current firmware revisions included in this firmware bundle:

DEVICE FIRMWARE REVISION

COMPONENT	FIRMWARE VERSION
HP Color LaserJet Enterprise MFP M480f	Firmware Datecode: 20210128 Firmware Revision: 2501232_004613
Embedded JetDirect:	JOL25010027
DC Controller:	7.108
HP Fleet Bundle Version Designation	Original Release FutureSmart 5.1
MD5 checksum for .bdl file	2f1a90b5294e1399257d7a499fc532fb

No Previous Releases -- Original Version

Installation Instructions

NOTE: Please be aware that an update in some circumstances may require 30 minutes or more to complete.

You can send the firmware update to a device at any time; the device will wait for all I/O channels to become idle before cycling power.

Please print a configuration page prior to performing any firmware update. To print the configuration page:

1. Go to the printer's control panel.
2. Swipe left and select the **Reports** menu.
3. Select the **Configuration/Status Pages** menu.
4. Select the **Configuration Page** option.
5. Select the **Print**.

On the printed Configuration page look in the section marked "Device Information" for the Firmware Datecode and Firmware Revision. The Firmware Datecode and Firmware Revision will look something like this:

Firmware Datecode: 20210128

Firmware Revision: 2501232_004613

The elapsed time for an update depends on the I/O transfer time as well as the time that it takes for the printer to reinitialize. The I/O transfer time depend on the speed of the host computer sending the update and the I/O method (USB or network).

The re-initialization time will depend on the specific hardware configuration of the printer, such as the number of EIO devices installed, the presence of external paper

handling devices, and the amount of memory installed. Finally, any print jobs ahead of the firmware job in the queue will be printed before the update is processed.

NOTE: When the update process has completed the LaserJet will need to be rebooted. Once the printer is back online, print a Configuration Page and verify that the new firmware has been installed.

Additional information to know

The firmware file will be in the following file format "xxxxxxx.bdl" where "xxx" indicates the firmware file name and the ".bdl" is the files extension.

This file requires an interactive update method. You cannot update the printer using the traditional FTP, LPR or Port 9100 methods of upgrading. Please use one of the following methods listed below to update the firmware of this device.

How to perform firmware upgrades.

Embedded Web Server: (control panel is at a Ready screen)

After uncompressing the file you will see a xxxxxxx.bdl file.

1. Open an Internet Browser Window.
2. Enter the IP address in the URL line.
3. Select the **Firmware Upgrade** link from within the General tab.
4. Select **Choose File** and browse to the location that the firmware upgrade file was downloaded to, and then select the firmware file.
5. Select the **Install** button to perform the upgrade.

NOTE: Do not close the Browser Window or interrupt communication until the Embedded Web Server displays the Confirmation Page.

6. The printer will automatically reboot unless you are downgrading. If downgrading Firmware you will be prompted to select the Rollback option.

NOTE: Please be aware that an update in some circumstances may require 30 minutes or more to complete.

Once the printer or MFP is back online, print a Configuration Page and verify that the new firmware has been installed.

Walk-up USB thumb drive: (Standard control panel menu)

After uncompressing the file you will see a xxxxxxx.bdl file.

1. Copy the xxxxxxx.bdl file to a portable USB flash memory storage device (thumb drive).

NOTE: USB Flash Drives that are not in a Fat32 format or having a CD formatted partition may not be recognized by the printer. You may need to try a different USB flash drive.

2. Turn the printer ON.
3. Swipe to the left and select the **Support Tools** application.
4. Select the **Maintenance** menu
5. Select the **USB Firmware Upgrade** menu.
6. Insert the portable USB storage device with the xxxxxxx.bdl file on it into the USB port on the front control panel of the product.
7. Select the xxxxxxx.bdl file you would like to use.

NOTE: If there is more than one xxxxxxx.bdl file on the storage device, make sure that you select the correct file for this product.

8. Select the **Install** button on the bottom of the screen.
9. Select the **Upgrade, Re-install or Downgrade** option depending on the task you are performing. The firmware upload process will begin.

When the upload is complete, the printer will reboot automatically and start the upgrade process.

NOTE: The upgrade process may take up to 30 minutes to complete. Please do not interrupt the updating process.

Once the printer or MFP is back online, print a Configuration Page and verify that the new firmware has been installed.

Pre-Boot walk-up USB thumb drive: (control panel Pre-Boot menu)

NOTE: Only to be used if the printer is not able to boot to READY

After uncompressing the file you will see a xxxxxxx.bdl file.

1. Copy the xxxxxxx.bdl file to a portable USB flash memory storage device (thumb drive).

NOTE: USB Flash Drives that are not in a Fat32 format or having a CD formatted partition may not be recognized by the printer. You may need to try a different USB flash drive.

2. Turn the printer ON.
 3. Press the **HP** logo in the middle of the screen when you see the "**1/8**" under the logo.
 4. Press the Down arrow to highlight **Administrator**, and then press OK.
 5. Press the Down arrow to highlight **Download**, and then press OK.
 6. Insert the portable USB storage device with the xxxxxxx.bdl file on it.
 7. Press the Down arrow to highlight **USB Thumbdrive**, and then press OK.
 8. Press the Down arrow to highlight the xxxxxxx.bdl file, and then press OK.
-

NOTE: Please make sure the firmware file is located in the root directory of the flash drive. If you have more than one .bdl file on your USB flash drive, select the file you want loaded and press OK.

Please be patient since this may take up to 10 minutes to complete.

9. When the message **Complete** appears on the control panel display, power cycle the printer.
 10. The printer will start the upgrade process and will continue to boot to the Ready state.
-

NOTE: Please be patient since this may take up to 30 minutes to complete.

Once the printer or MFP is back online, print a Configuration Page and verify that the new firmware has been installed.

Web Jetadmin (Supported with version 10.4 SR1 with FP4 or newer)

Please visit www.hp.com and type "Web Jet Admin" in the "Search" Box to find more information about new releases of Web Jetadmin and the release note information for those releases.

Upgrading Firmware:

1. Start Web Jetadmin 10.4 SR1 with FP4 or newer
2. From the "Device Management" section, select "All Devices" (or the appropriate device group). An "All Devices" list will appear in the center window.
3. Find your device in the list, or type the IP address of the device in the Quick Device Discovery section in the lower-left of the screen (this will highlight your device in the device list). You can sort the device list by clicking on a column name at the top.

- 4.If your device list is sorted by model number, you may select multiple devices with the same model number by Control-Click or Shift-Click.
- 5.Right-click on the device and select "Upgrade firmware...".
- 6.An Upgrade Firmware window will appear. Select "Device firmware" and click "Next"
- 7.A list of available firmware will appear. If the correct version is listed, click "Next", and the upgrade process will start.

NOTE: If the correct firmware version does not appear within the list, you will need to manually upload it into WJA. New firmware may be available on an FTP site prior to appearing on hp.com. The instructions below allow you to upload a firmware file from your local PC to WJA 10.4 SR1 with FP4 or newer

Uploading new firmware files into WJA:

1. Click on "Firmware/Firmware Repository" in the "Device Management" pane
2. A "Firmware Repository" window will appear in the center of the screen
3. Click on "Upload" in the upper-right of the window
4. Browse to the .bdl file on your local PC
5. Click "Upload"
6. Once the .bdl file is uploaded, go back to step 2 in the first section and complete steps 2 through 6.

NOTE: Do not turn printer off during the update process! When the update process is complete, the printer will automatically reboot. If the firmware update process fails, Web JetAdmin will provide notification with a page (screen) of information regarding the reason(s) for failure. A link will be provided to attempt the process again.

System Requirements

The Firmware upgrade process requires a network or USB port connection.

Technical Assistance

Some of the services below are provided for the United States only. Similar services to those listed below are available in other countries. See your printer's user guide or call your local authorized HP dealer.

Customer Support

See your printer's user guide or call your local authorized HP dealer.

Internet

An anonymous FTP library service is available worldwide for around-the-clock access to drivers and technical support information for HP peripheral and computer products.

Please note that paths may change without notice. Access the Internet or FTP address and use the menus to locate the software or support of your choice.

URL for HP Color LaserJet Enterprise MFP M480fSeries Support:

URL for Firmware downloads:

www.hp.com/support/colorljM480MFP

URL for Support:

<http://www.hp.com/go/support>

Additional Information

Refer to your printer's user guide for additional methods of obtaining software and support information, such as printer driver distribution centers other online services, fax services, and other online support.

Legal Statements

Trademark Notices

MS-DOS, Windows, Windows 2000, Excel 2000, Microsoft Office, Windows Server 2003, Outlook, PScript and Internet Explorer are registered trademarks of Microsoft Corporation in the United States and/or other countries.

PostScript is a registered trademark of Adobe Systems Incorporated.

Quark and QuarkXpress are trademarks of Quark Inc.

Mac, Macintosh and Safari are registered trademarks of Apple Computer, Inc.

The Adobe logo, Acrobat, the Adobe PDF logo, Distiller, and Reader are either registered trademarks or trademarks of Adobe Systems Incorporated in the United States and/or other countries.

Novell is a registered trademark of Novell, Inc., in the United States and other countries.

Netscape Navigator, is a registered trademark of Netscape Communications Corporation in the United States and other countries.

License and Copyright

© Copyright 2021 HP Inc., L.P.

The information contained herein is subject to change without notice. The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein