

# Firmware Release Note



Model : SL-C1860FW	Date :	November 1, 2016
--------------------	--------	------------------

Version	Category	Change Description
<b>V4.00.02.12</b> (30-Apr, 2014)	Fix Defect	Fixed the scan to pc issue via USB
<b>V4.00.02.17</b> (7-Aug, 2014)	Add Func.	Add Samsung Cloud Print Function
<b>V4.00.02.20</b> (20-Aug, 2014)	Fix Defect	Fix the keypad issue
<b>V4.00.02.23</b> (17-Nov, 2014)	Fix Defect	Remove unused Network Port such as TCP 22 port.
	Add Func.	Google Cloud Print 2.0 feature
	Fix Defect	Russia summer time issue
	Fix Defect	Not display Hebrew download font.
<b>V4.00.02.28</b> (5-Mar,2015)	Fix Defect	SMB scanning issues with Mac 10.10 Yosemite
		[Google Cloud Print] Print & deregistration doesn't work properly
		Scan to PC is not working when the Drivers Installed through Network.
		HOME Screen flickers if paper is added/removed from ADF
		Multiple Scan id's are Created through Network Port.
<b>V4.00.02.29</b> (7-May,2015)	Add Func.	Apply PostScript
<b>V4.00.02.30</b> (29-June,2015)	Fix Defect	LCD Calibration can't be done from Display screen
<b>V4.00.02.34</b> (1-Oct, 2015)	Add Func.	Apply the QR Code on Configuration Report
		Apply the new font in PCL5, PCL6
		Apply the toner status and easy setup of Samsung Cloud Print
	Fix Defect	Auto Color Registration value storing when factory memory clear is executed
		Scan to Print job through ADF gets cancelled for A4 size with PHOTO mode
<b>V4.00.03.02</b> (24-Mar, 2016)	Fix Defect	Changed the OPE Parts * The parts and firmware are not compatible between old and new parts.

<b>V4.00.04.06</b> (1-NoJune,2016)	Fix Defect	Address Book gets deleted after Firmware Upgrade
		Some configuration values are not retaining after firmware upgrade. (Machine Settings, Network Settings, System Security, Network Security, User access control value)
		When 'WEP' AP is selected on LCD Panel, WPA password-input popup is shown.
		Scanned image/text is not getting scanned properly via ADF after cancelling Flatbed Scan
	Add Func.	Apply to PrinterOn

※ Note

- Please do not turn off the printer and your computer until firmware update finishes.
  - If you are using USB connection, disconnect all other USB printers from the PC.
  - The firmware update you are about to install has been tested for compatibility with Samsung toner cartridge products ONLY.
- Installing The upgrade may cause a non-Samsung toner cartridge to malfunction.
- Do not run your printer during the firmware update.(Do not have any print job)

## **Before updating the firmware, Check the current f/w version.**


**If V4.0x.02.34 and more than lower, Use the ver 4.00.02.34 f/w file.**

**If V4.0x.03.02 and more than higher, Use the latest(high) version.**

## **How to update the firmware using a USB cable.**

1. Make sure that the machine is connected to the PC with a USB cable.
2. Menu > Setup > Admin Setup > Firmware Upgrade > ON
3. Drag the firmware file(\*.hd) and Drop down it on usblist2.exe.

And then, firmware update will be started automatically.

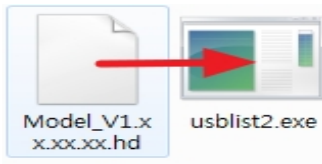

4. The firmware update will start.

Once the firmware update is complete, the machine will be rebooted automatically.

## **Updating from the Network**

1. Go to the SyncThruWeb Service (SWS) main home page.

Login as Admin in SyncThruWeb Service.

NOTE: Login using the Administrator ID and Password established during initial machine setup.

2. Click [Maintenance] on the top menu.

And then click [Firmware Upgrade] or Application Management > Application

3. Click Add button

4. Click [Browse]. Choose installation file by browsing file system. And click OK button

5. The uploading step will start. After this step, next step will be started automatically.

6. The firmware update will start.

7. Once the f/w update is complete, the machine power-off and power-on automatically.